

CNC Router user manual

Jinan Ruofen Laser Machinery Co.,Ltd

Website: www.ruofencnc.com

Service Contact information :

Email: service@ruofencnc.com

Skype: lifancnc

Please send us your Order No. , we will do our best service for you.

Customer First Service First Quality First

Contents

1. Foreword-----	2
2. Part names and function-----	3
3. Installing and Operating-----	5
4. Maintenance-----	14
5. Caution-----	15
6. High-speed woodworking CNC Router -----	15
7. Electrical appliance-----	16
8. Tips-----	17
9. Appendix-----	18

1. Foreword

Thank you for purchasing our CNC router!

We professionally manufacture of CNC Router in China. The routers are used for woodworking, advertising (manufacturing signs, marks and decoration), furniture, mould and crafts.

In the Introduction describe the Installation and maintenance, analyze of the normal malfunctions, simple engraving techniques in detail.

CNC Router is of high precision machine. Inaccurate installation and operation would affect the precision, stability and working lifetime. Please peruse the Introduction in order to correctly operation and maintenance. Keep the safety.

Please keep the user's manual for further use.

1. To ensure correct and safe usage with a full understanding of this product's performance, please be sure to read through this manual completely and store it in a safe location.
2. The contents of this operation manual and the specifications of this product are subject to change without notice.
3. The operation manual and the product have been prepared and tested .

If you find any misprint or error, please inform us.


2. Parts and functions

Accessories of CNC router

Standard parts

Please check the number of the following parts. Please contact with us if any item is omitted.


Item	Name	Specification	Quantity	Remarks
1	Wood Tool Box		1box	
2	Collet(1.5kw spindle no 12.7Φ)	3.175 Φ 4Φ 6Φ 12.7Φ	4pcs	
3	DSP Controller		1pc	
4	IDE cable of DSP Controller		1pc	
5	Hexagon ring spanner		0pc	
6	Open-ended spanner		2pcs	
7	DSP Installing CD		1pc	
8	User's Manual		1book	
9	Warranty Card		1pc	
10	Bucket		1pc	
11	Power Cord	1.5m	1pc	
12	Clamp		6pc	
13	Water Pump		1pc	

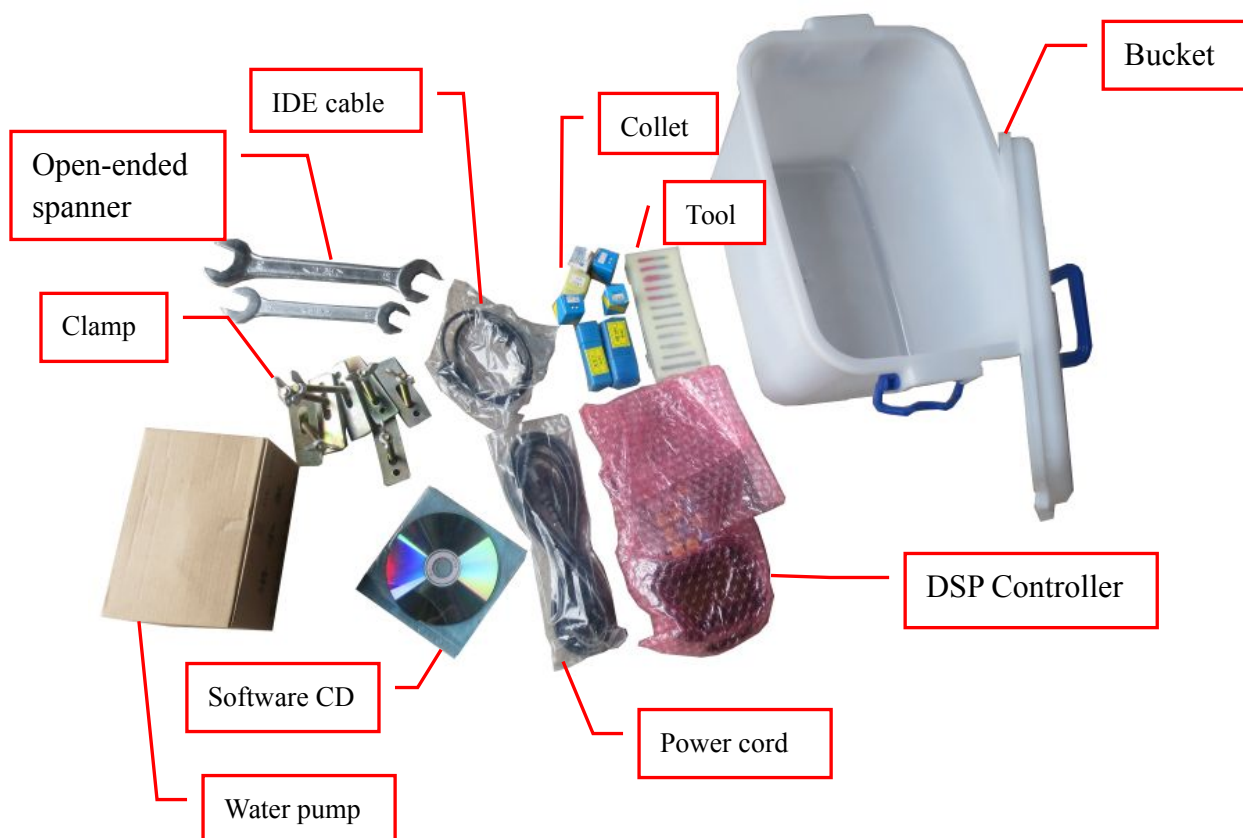


3. Installing and Operating

1) connect the power

First from the circuit breaker output three firing line ,one null line ,one ground line .and connect to machine .as picture :

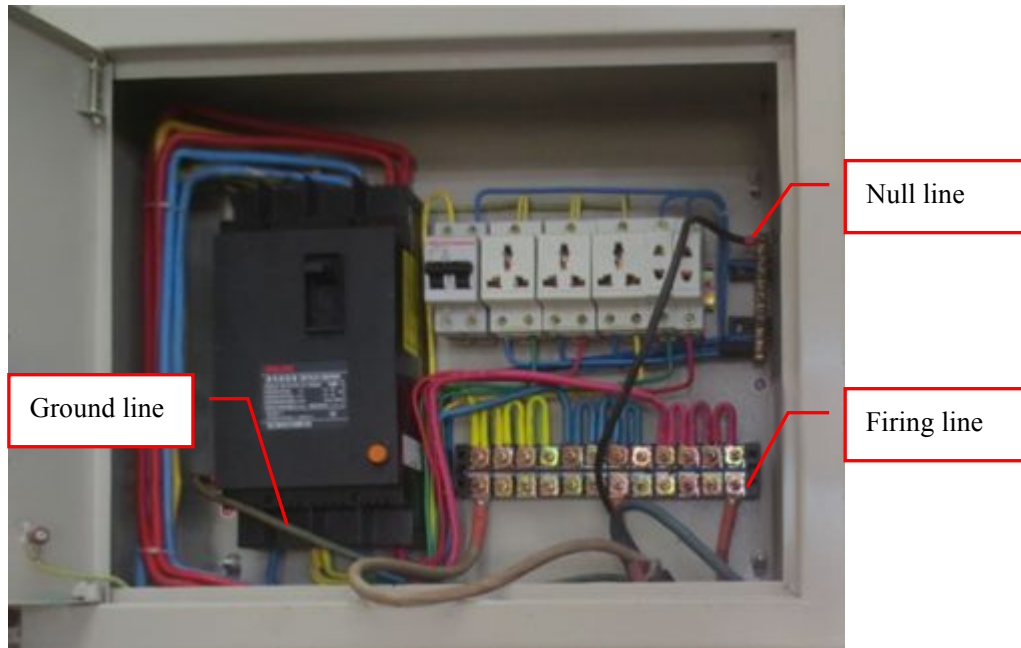

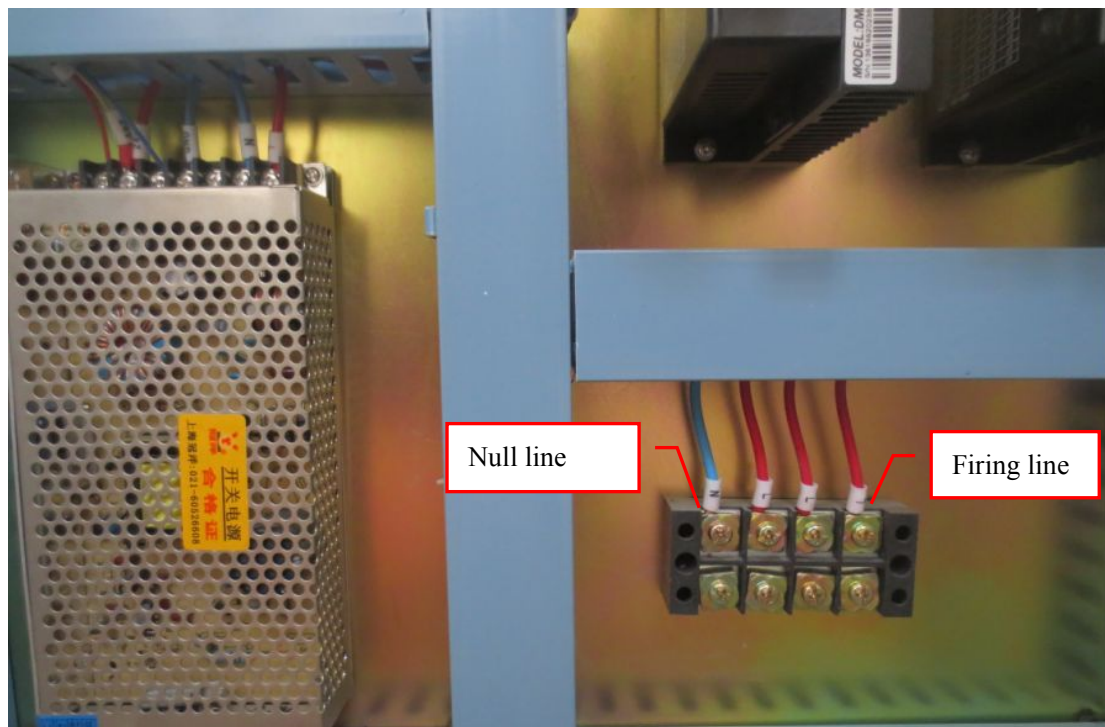

2). DSP NK105 operating




◆ Basic Configuration of NK105 System

Memory: 128M


Flash: 256M

Monitor: 128 × 64 graphic LCD module


1. Install machine :machine most already contact good,,you only need install DSP to control box,so picture:

 
 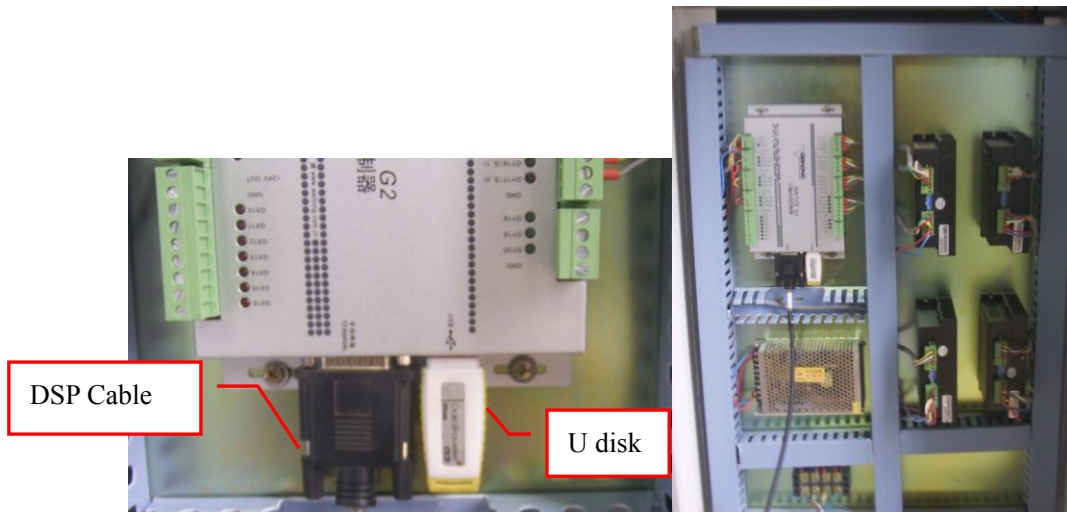


 

 
 

 


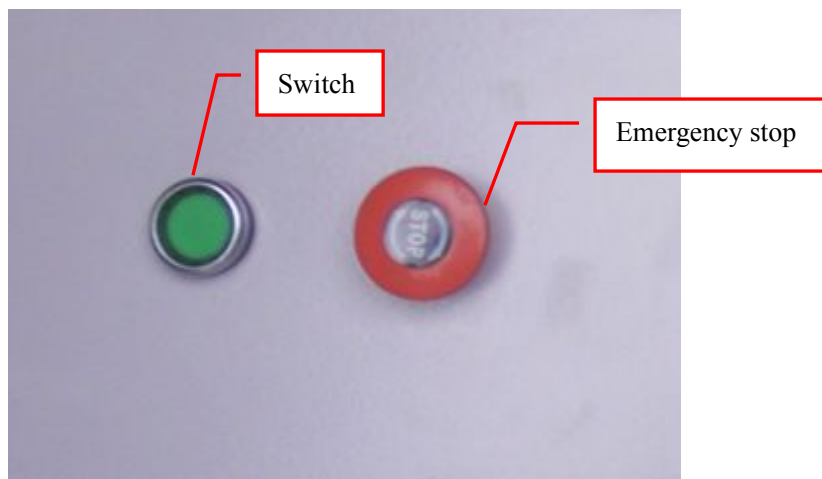




 

2. After install complete ,open power switch . Green ---switch button Red -----scram button


 






 


3. DSP screen button function

	Override+	Increase of feedrate override; input of number 7; increase of spindle gear with the help of auxiliary key when spindle port has input
---	-----------	---



	Y+	Positive shift of Y axis; input of number 8; switch between MCS and WCS with the help of auxiliary key
	Z+	Positive shift of Z axis; input of number 9
	X-	Negative shift of X axis; input of number 4; returning to mechanical origin with the help of auxiliary key
	Spindle start/stop	Start or stop of spindle under manual mode; input of number 5; backing to workpiece origin with the help of auxiliary key
	X+	Positive shift of X axis; input of number 6
	Override-	Decrease of feedrate override; input of number 1; decrease of spindle gear with the help of auxiliary key when spindle port has input
	Y-	Negative shift of Y axis; input of number 2
	Z-	Negative shift of Z axis; input of number 3
	Speed switchover	Switch between manual high/low speed; input of number 0; tool presetting with the help of auxiliary key
	Backing to origin	Backing to origin of X and Y axes; input of minus; backing to origin of Z axis with the help of auxiliary key
	Menu	Entering menu page; input of decimal point; entering image update page at the time of system start-up


	Start	Start key; breakpoint resuming with the help of auxiliary key
	Up	Suspend processing; up direction key
	ESC	Stop processing; cancellation of various selections, inputs and operations
	Shift	Auxiliary key
	Down	Down direction key
	OK	Entering manual high/low speed adjustment page under menu page; confirmation of various selections, inputs and operations

Shift + 	Increase of spindle gear
Shift + 	Switch between WCS and MCS
Shift + 	Backing to mechanical origin
Shift + 	Backing to workpiece origin
Shift + 	Decrease of spindle gear

Shift + 	Floating presetting
Shift + 	Z clear
Shift + 	Breakpoint resuming
Shift + 	Entering help page

4. System Start-up

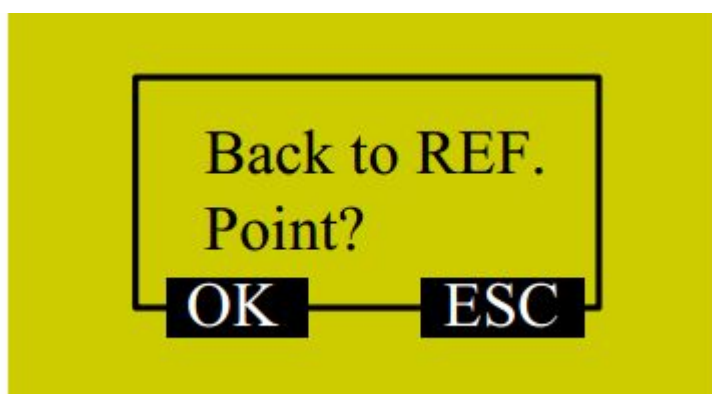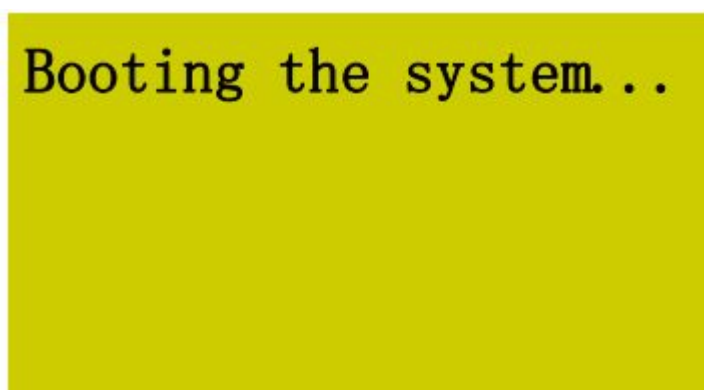

Press  : Machine Z X Y backing to mechanical origin.

First time you can point , check relevant parameter.

Main parameter :



→ Oper Param

- 1. G00 speed: 8000mm/min (travelling speed)
 2. Gxx speed: 5000mm/min (working speed)
 3. Back REF first: no

(Mfr param) Password (33587550)


2 (axis outpdir) 1. X Positive 2. Y Positive 3. Z Positive (according to machine moving direction change)

3 (pulse equivalent) X :0.0098125 Y : 0.0098125 Z: 0.00625 (normal straight rack box)
 X:0.01128375 Y: 0.01128375 Z: 0.00625 (casting straight rack box)
 X:0.0115724 Y:0.0115724 Z 0.00625 (normal helical rack box)

4 (Machine strok) 1.strkupperlmt : X 1300 Y 2500 Z 0 (for example :1325)
 2.strklowerlmt: X 0 Y 0 Z --200

5(spindle set) 3. Initial gear --change 7

Load the file

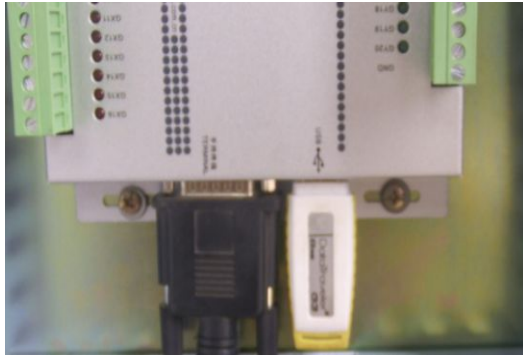

install U disk



→ 2 (Browse U disk file)

①Ld②De③Copy




1.load 2.delete 3. Copy , choose 1 load life , then must press , show right number on file, as picture,





Then press ok, file is loaded .


Make the workpiece origin :

- 1) first move the machine spindle to left bottom of workpiece .

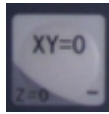

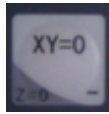2) Then press , x and y axis clear 0 , x and y origin is ok

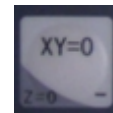

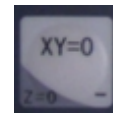3) Sharp of the tool touch the surface of workpiece .then press shift + , z axis clear 0 , z axis origin is ok . As above picture .



4)  press this button , machine start to work.

4. Maintenance

- i The new machines have the wear-in period. We should adjust the machine during this period. One week later, we should check the conjunction of the parts. The main parts are as follows: The conjunction of the side board and

the beam, the conjunction of the soleplate and the side board, the coupler between the stepper motor and the Y axis ball

screw, the fixed screw in the front of the ball screw.

Fixed Screw
Side Board
Linear
Soleplate
Fixed Screw

ii Maintenance after use.

- (1) Clear the machine after use.
- (2) Filling oil after cleaning.

Motor
Coupler
Side Board
Linear
Y-axis Orbit (oil point)
Soleplate
X-axis Ball Screw (fixed ball screw)
X-axis Orbit (oil point)

iii Remarks:

Different material and condition, the period of maintenance are different.

Such as: HD board, we should clear it in 3 days. Wood, we should clean it in 7 days.

The main points as follows:

Y-axis Motor
Y-axis Ball Screw (oil point)
Side Board
Water Cooling Motor

□ CAUTION □

5. Caution

1. Don't use un-rating voltage for Xinhuiyou C and Z series CNC routers.
2. Please operate the machine strictly according to the manufacturing size of CNC router.
3. Forbid high strength, overload work.
4. After the using and the cleaning of the 1218 ball screw machines or larger, the gantry should be stopped in the center of the machine, in order to avoid the

spontaneous droop of the ball screw which will influence the concentric degree and the accuracy.

5. When encounter smoking, awful smell, noise and other abnormal situation of the machine, please turn off the machine and check it.
6. Make sure the machine connect with the ground wire.
7. Don't touch the tip of the blade.
8. Don't use causticity liquid to clean parts and the keyboard of the machine.
9. Different materials and cuttings, choose different cutters and speed.
10. Turn on the spindle motor before positioning the Z axis and cutting mode.
11. Before using of the machine, please check the water circulation to ensure the spindle work well.
12. Don't damage or change the original wire, don't pull it, bind it or press it.
13. Don't touch the cutter and spindle by hand while working.
14. Don't drop the liquid and metallic parts to the machine. After using, lubricate the ball screw, feed shaft, orbit and rack.
15. Working temperature: 0°C-45°C
16. Cover the bullet while working to prevent the dust drop into the water and block the spindle.

6. High-speed CNC router

The high-speed CNC router is driven by the gear wheel of the X and Y axis, which integrate the validity, speed, capacity.

The gear belongs to the manufactured parts, it needs to run in period which to fill the gap between the gear wheel. After the running, we should adjust the machine. The methods are as follows:

1. Turn off the cover of the side plate and main spindle.
2. Use hexagon ring spanner to loose the fixed screw of the driven box.
3. Pull the driven box in the direction of the picture till there is no gap. Don't use heavy thing to knock the driven box.
4. After adjusting, screw down the fixed ball of the driven box, then turn on the power, after running the machine and make sure there is no mistake, assemble the machine head cover and the side board cover.

Maintenance:

1. Clean the orbit, gear wheel, ball screw periodically.
2. Use butter and normal machine oil for the gear wheel and gear axis in proportion of 3:2.
3. The gear wheel needs to be cleaned and lubricate it periodically to avoid rusty.

4. Check the tightness of synchronous belt and adjust it in time.

X-axis Beam Fixed Screw

Driving Box Fixed Screw

Ball Screw

Driving Box

High Speed Direction

7. Electronic Parts.

The map of electronic parts of CNC router. Pic.6

Maintenance of electronic parts:

1. Clean the motor and the dust in the control box to heat emission.

2. Check the wire, such as: knot, twist and abrasion.

Emergency Stop Main Switch

Filter

Frequency Converter

Transformer

Driver

Water Cooling Spindle

Stepper Motor

Stepper Motor

Stepper Motor

Analysis of normal malfunction and maintenance

Fault	Fault Reason	Remove The Fault
Arise the phenomenon of disturb, lost step, in the cutting process	Spider coupler loose	Screw down the spider couplers
	The driver lost step	Change the controller
	The numerical card loose	Insert the numerical card firmly
Arise the phenomenon of rack wave etc when the cutting process	Loosen of fixed screw of the ball screw or the guide block lead to the decrease of the accuracy; adjust the concentricity then screw down the screw.	Adjust the concentricity then screw down the screw.
When turn on the machine, the spindle motor moves to one direction or noisy, turn off the machine.	The wire breaks inside when running or the loose of the jointing point.	Use the gauge to check where the disconnection point is, then change the wire.

When the machine is running the driven system arise noise and have the phenomenon to be block.	There is dust in the ball screw or the lacking of the oil.	Discharge the bearing and clean it or change, then add oil and assemble.
The limit switch lost the function or the screen show the limit alarm in a long time.	The limit switch broken or the switch wire breaks inside or the inside of the switch stick, the emergency stop is on.	Change the switch, check the circuitry, and turn off the emergency stop.

8.Tips

Wood cutting

Wood is the main important material of modern decorations. There are many new designs of wood cuttings. Different materials, the cutting method is also different. The following is the introduction of different materials.

1. If the wood is soft and more flexible adopt to cut the wood-wool in landscape orientation, the speed of the cutting should be faster gradually.
2. If the wood material is hard and the texture is too tight, pay attention to the speed of the cutter going into the material. First it should be slowly, after it cuts a gap in the material, and then add the speed.

Steel cutting

Hardness of steel is several times than wood. The following is the introduction of steel cutting.

1. Choose the special cutter for steel.
2. In the process of cutting adjust of the cutting speed and add cooling oil to the cutter.
3. If the depth of the material is too thick, we should cut it layer by layer.

Stone cutting:

The inner structure of the stone is high intensity not uniform.

Stone belongs to the material which the intensity of the inside structure is not uniform.

Due to hard intensity of the stone, the requirement of the cutter is high; besides, the stone cutting also has the requirement to the rotation speed of the spindle motor.

When cutting the stone, please choose the wearable alloy cutter with high intensity, and pay attention to the cooling of the cutter and the spindle.

The above introduction only for reference, please operate according to the actual situation.

9. Appendix

The parameter of cutter

Different materials should be different cutter and parameters.

Materials:

Dual-color board, ABS board, organic glass, PVC board, metal (iron, alloy, brass, aluminum), glass, stone, wood, high density board, anti-firing plate, chipboard, composite material (brass board, aluminum plastic board, colophony board, soften material (hard latex products, soft latex product), small name seal material, organic glass seal, ox horn seal, brass seal, steel seal, latexseal,

colophony board, stock ink cushion, atom seal etc.

Applied: chest card, construction mould, steel mould, letter mould, seal, furniture, cutting graphics, gift, souvenir making, adverting letter cutting, engraving...

During the processing, different materials should be different cutter and parameters.

1. Dual-color board

If cutting depth is less than 0.8mm, speed of the spindle should be 10000~20000 r/min; the traveling speed is 2.4m/min. If the angle and width are smaller should decrease the cutting speed. The blade $30^\circ/0.3$ (or less than $30^\circ/0.3$) should not be used in the frame cutting. The speed should be 0.6m/min.

2. PVC, ABS board

PVC board (less than 0.5mm), ABS board (less than 1mm), when making the mould, the rotating speed of spindle should be 20000-40000 r/min, the cutting speed should be 1.2m~2.4m/min.

3. Nonmetal inorganic material

Material	Blade	Rotation Speed (rev/min)	Cutting Speed (m/min)	Blade Down Speed	Remarks
Marble	$20^\circ \sim 30^\circ$ $/0.1 \sim 0.3$	20000~40000	0.3 average low speed	0.2~0.4	
	$20^\circ \sim 30^\circ/0.3$ above	20000~40000	0.3 average low speed	0.3~0.4	
	40° above	20000~40000	0.6	0.3~0.5	
Glass	$20^\circ \sim 30^\circ$ $/0.1 \sim 0.3$	20000~40000	0.3	0.1-0.2	
	$20^\circ \sim 30^\circ/0.3$ above	20000~40000 40000	0.3 0.6~2.4	0.1~0.4 0.1	

	40 ° above/0.3 above	20000~40000 40000	0.3 0.6~2.4	0.1~0.4 0.1	
For stone cutting please take the above parameters for reference, the harder stones should deduce the speed.					

4. Wood

Material	Cutter	Rotate Speed (r/min)	Cut Speed (m/min)	Travel Speed (m/min)	Remarks
Engrave	20°-30°/0.1-0.3	20000-40000	0.8-2.4	0.5-2	
	30°/0.3	20000-40000	1.2-2.4	1-3	
Cut	φ8-φ13	10000-20000	0.3	1-3	
	φ8	10000-20000	0.3	3-8	
Different material, density sheet or fireproofing sheet, adjust the parameter of cutter and blade.					

5. Organic Material

Material	Cutter	Rotate speed (r/min)	Cut speed (m/min)	Travel Speed (m/min)	Remarks
Organic glass Ox horn stamp	Engrave	20°-30°/0.1-0.3	10000-40000	0.6-0.8	0.2-0.8
		30°/0.3	10000-40000	0.8-2.4	1-3
	Cut	φ0.8-φ1.3	10000-40000	0.3	1-3
		φ2.5-φ3	20000-40000	0.3	5-10 Big power motor
Hard plastic	Engrave	20°-30°/0.3-0.5	10000-20000	0.6-1.6	0.3-0.1
		30°/0.5	10000-20000	2.4	0.5-1
	Cut	φ0.8-φ1.3	10000-20000	0.6-1.6	0.5-1
		φ1.5	10000-20000	0.8-1.6	0.5-2
Soft material	20°-30°/0.3		40000	0.3-0.6	1-20
	40°/0.3		40000	0.6-1.2	1-20

The above parameter is only for preference. Please adjust the parameter accord to different material, cutter and precision.

(1) Hard material

If the cutter is small and the material is hard, deduce the depth of cutter on the clamp and deduce the cutting speed. If it needs the big depth for the cutter, deduce the speed of spindle. If you need the high light degree for your products, deduce of cutter on the clamp, improve the speed of spindle, improve the cutting speed and add the superposition.

(2) Soft material

If it needs the high light degree for your products, please improve the speed of spindle and deduce the cutting speed and add the superposition under the material not insert the cutter.

The parameter isn't absolute, please adjust the parameter accord to the your condition. You will find your favorable parameter. So it can reach to the best efficiency under the good precision and quality. Please take care the abrasion of cutter when engraving the material. The abrasion of cutter will affect the effect.